

Manhole Inspection Summary

Manhole # S19GG2026MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **19GG2** Node: **026** Status: **Abandoned - Admin (Do Not Change)** Insp Date: **4/24/07 10:40 AM**

Incomplete Comments

Crew: **JJ, BC**
Inspector: **Jensen, J**
Firm: **RKK**

Location Address: **5910 FALLS RD** Cross Street: **WASHINGTONVILLE**

Manhole Type: **Inline** Location: **Sidewalk** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The O12 pipe seal is not flush to the pipe. This MH may be abandoned.**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0.5** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **45** (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **42** (in.) Length: (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps Count: **8** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S19GG2026MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View



Bench and Channel debris.

Defect



Frame leaks. Adjustment deterioration, loose brick and infiltration. Corbel and Barrel infiltration

Defect



Frame leaks. Adjustment deterioration, loose brick and infiltration. Corbel and Barrel infiltration

Defect



Frame leaks. Adjustment deterioration, loose brick and infiltration. Corbel and Barrel infiltration - other side.


Manhole Inspection Summary

Manhole # S19GG2026MH

Printed On: 12/17/2008

Page 3 of 3

12 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

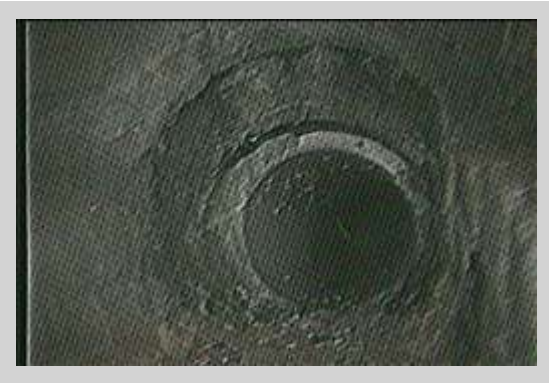

Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.84** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **0.5** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 8 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.77** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection